

Booking Details

Name IQ594NDSKW - Groove Earthworks Sam O'Rouke
Email sam@grooveearthworks.com.au
Contact 0423748467
Date 22/11/2024
Store Lawnton (OLD - DO NOT USE) - 3881 1755

Client Concerns

has had all suspension done and has been told to do wheel alignment, DO NOT TEST DRIVE AS PER CUSTOMER REQUEST

Vehicle Details

Rego: 556KJ8
VIN: WVGZZC1ZPY052063
Mileage: 202,682 KM
Make: HOLDEN
Model: H SERIES
Year: 1976
Variant: 5.0 RWD Sedan HX

Thank you for trusting the team at Pedders Lawnton (OLD - DO NOT USE) - 3881 1755 with your vehicle. As requested, one of our specialist technicians has completed a comprehensive Pedders Brakes, Steering and Suspension Check including a visual inspection of undercar components. Repairs required and/or upgrades suggested have been separated into four sections to enable you to prioritise your vehicle's repair.

Please note: This is a summary report - a detailed workshop copy of this report can be made available on request.

Client Concern: Your reason for contacting Pedders.

The repairs related to your Prime Item of Concern - your primary reason for contacting Pedders - will require the following:

SERVICE CHECK ITEM	COMMENT	SUGGESTED REPLACEMENT	QTY REQD
FRONT OTHER	Good build. Oil leaking onto exhaust manifold on RHS.		
 			
REAR OTHER	Diff locked. Could not run on test lane.		
BRAKE STEERING AND SUSPENSION CHECK	Brake, Steering and Suspension check completed today.		
FRONT WHEEL ALIGNMENT	Toe adjustment completed today. Rebook for shim alignment.		

Urgent - Failed: Vehicle Requires Immediate Attention.

Our expert technician has identified the following items as an Urgent - Failed. These are critical safety items that require immediate attention.

SERVICE CHECK ITEM	COMMENT	SUGGESTED REPLACEMENT	QTY REQD
REAR WHEEL CYLINDERS	Leaking. Requires replacing		

SERVICE CHECK ITEM	COMMENT	SUGGESTED REPLACEMENT	QTY REQD
		PZ-5950 Non-Pedders Brakes (Other) Miscellaneous	2.0
		BRAKEFLUSH Brake Fluid Flush	1.0
		ZPBRAKEFLUID Brake Fluid	2.0
			
			

Failed: The Identified Items Must be Rectified within 6 months or 10,000 km to ensure vehicle safety

These are further items that in our opinion are likely to become unserviceable within 6-months or 10,000kms. We have based this advice on our experience of both the vehicle type and model, kilometres travelled and the likely driving situations encountered.

SERVICE CHECK ITEM	COMMENT	SUGGESTED REPLACEMENT	QTY REQD
FRONT OUTER TIE ROD ENDS	LHS toe rod bent		
FRONT BEARINGS OR HUB ASSEMBLIES	Both sides excessive movement. Recommend adjustment. LHS has 2 damaged threads on studs. Has pulled threads from 2 wheel nuts. Requires replacing. RHS missing 1 wheel nut. Both sides should have hub centric rings to help wheel stay centred.	LABOUR Labour Cost	1.0
		WORK1 WORKSHOP CONSUMABLES	1.0
			
			
			
REAR WHEEL BEARINGS OR HUB ASSEMBLIES	Incorrect wheel nuts for rim style. No hub centric rings.		

Suggested Upgrades: Our expert suggestions to enhance your vehicle's performance, drivability, and suitability for your specific needs.

These are items that may not be in need of replacement but have been suggested for upgrade following a greater understanding of your driving situation and requirements.

SERVICE CHECK ITEM	COMMENT	SUGGESTED REPLACEMENT	QTY REQD
FRONT OTHER	COIL 10MM SPACER	EP1271/10 Pedders Urethane Coil Spring Spacer 10 mm (1 PKT)	2.0
		WA Front Wheel Alignment	1.0
FRONT ROTORS	278mm. Recommend replacing with pads	PZ-5075 Non-Pedders Rotors - Rear	1.0
FRONT PADS	Near Min Thickness - Recommend Replacement	PZ-5060 Non-Pedders Pads - Front	1.0

Pass: Our expert technician has inspected and passed the following items.

The following items have been inspected and passed for re-inspection in 6 months or 10,000km.

SERVICE CHECK ITEM	COMMENT	SUGGESTED REPLACEMENT	QTY REQD
BRAKE FLUID CONDITION			
			
FRONT SHOCKS			
FRONT SPRINGS / TORSION BARS			
FRONT BUMP STOPS			
FRONT LOWER CONTROL ARM & INNER BUSHES			
FRONT LOWER BALL JOINT			
FRONT UPPER CONTROL ARM & INNER BUSHES			
FRONT UPPER BALL JOINT			
STEERING GEAR CONDITION			
FRONT INNER TIE ROD ENDS			
FRONT IDLER ARM			
PITMAN ARM			
FRONT DRAG LINK			
FRONT SWAY BAR & BUSHES			
FRONT SWAY BAR LINKS			
ENGINE MOUNTS			
FRONT WHEELS			

SERVICE CHECK ITEM	COMMENT	SUGGESTED REPLACEMENT	QTY REQD
FRONT TYRES			
REAR SHOCKS			
REAR SPRINGS			
REAR BUMP STOPS			
REAR TRAILING ARMS - UPPER			
REAR TRAILING ARMS - LOWER			
REAR WHEELS			
REAR TYRES & SPARE TYRE			
REAR DRUMS			
REAR BRAKE SHOES			
REAR SHOE HARDWARE			
REAR HOSES & LINES			
PARK BRAKE			
FRONT CALIPER			
FRONT HOSES & LINES			
MASTER CYLINDER			
BOOSTER & VACUUM LINES			

Please note that this report is completely obligation-free. At your request, an estimate of parts and labour can be provided for the complete job or can be prioritised and split to suit your requirements based on the information provided in this report and discussions with our team. Labour savings may apply for completion of the complete job at once compared to splitting the job across multiple jobs.

Thank you again for trusting Pedders Lawnton (OLD - DO NOT USE) - 3881 1755 with your vehicle. Please contact our team at your earliest convenience on [07 3881 1755](tel:0738811755) or lawnton@pedders.com.au to discuss your Brakes, Steering and Suspension Check and any other requirements.

Yours Sincerely,

The Pedders Lawnton (OLD - DO NOT USE) - 3881 1755 Team